


- 1/ Adjust the two signal geneartor levels so that both the 8 & 11MHz signals are -10dBm at the output of the 10dB attenuator.
- 2/ Insert the 3.5MHz filter inline & check that the 3MHz OpIP2 signal is lower than -89dBm with the 10dB attenuator fitted
- 3/ Insert the 5.5MHz filter inline & check that the 5.5MHz OpIP3 signal is lower than -40dBm with the 10dB attenuator fitted

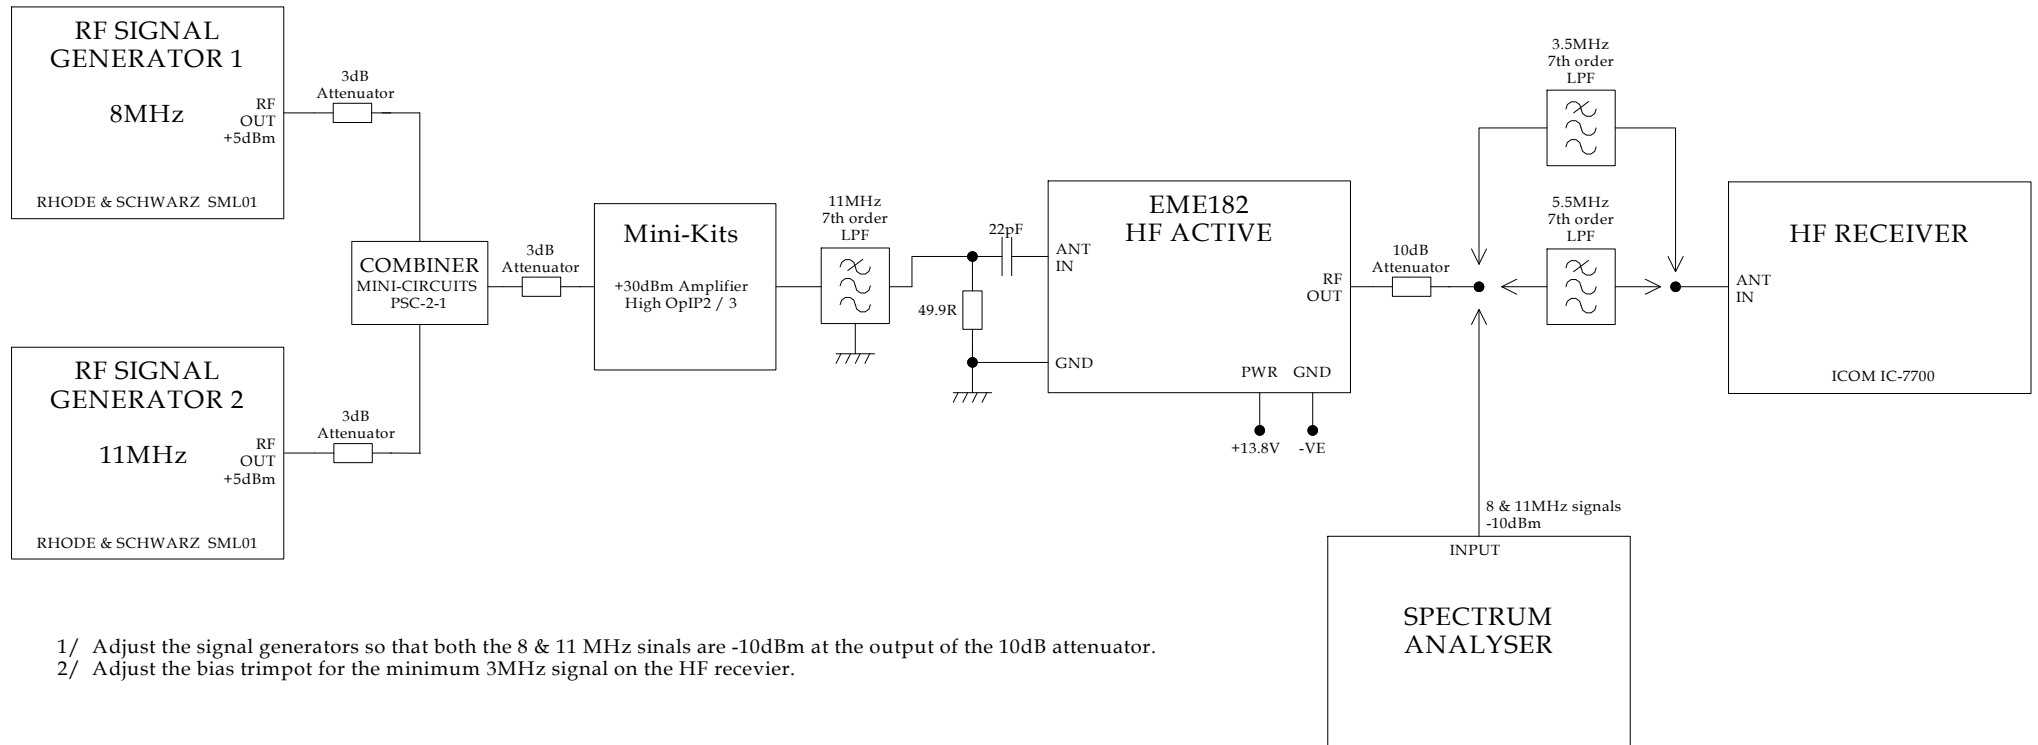

- 1/ Adjust the signal generators so that both the 8 & 11 MHz signals are -10dBm at the output of the 10dB attenuator.
- 2/ Adjust the bias trimpot for the minimum 3MHz signal on the HF receiver.

DRAWN MINI-KITS
 DATE 12-12-2014
 PROJECT EME182 ACTIVE ANTENNA
 FILE EME182 ALIGNMENT.SKF
 PROTECT COPYRIGHT MINI-KITS 2014

EME182 OPIP2 ALIGNMENT